

# exail

## Acceptance test report

00138076

Component

NIR-MPX-LN-02-00-P-P-FA-FA-LIL


Serial number

15749-09

### Packaging-interfaces

Input fiber	Polarization maintaining, Panda type		
Output fiber	Polarization maintaining, Panda type		
Jacket type	900µm outside diameter		
Input optical connector (orientation)	FC/APC		Key // slow axis
Output optical connector (orientation)	FC/APC		Key // slow axis
Input fiber length	1.5 meter		
Output fiber length	1.5 meter		
Input RF port	50Ω, female K		

### Product dimension and pin-out

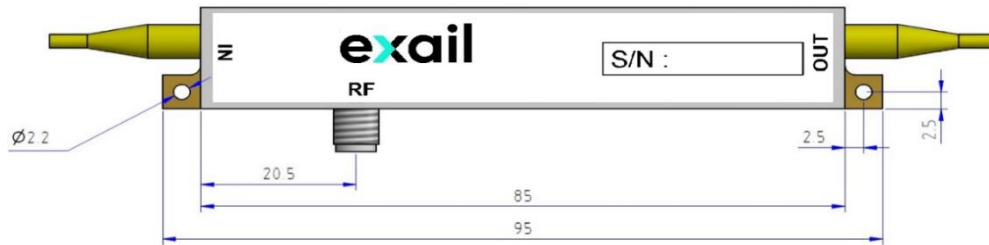

Thickness : 9.6mm  
Material : KOVAR

Package dimensions in mm

Measured with : Eagleyard module laser  $\lambda = 1060 \text{ nm}$

Parameters	Conditions	Measurements	Specifications
Insertion Loss	with input connection	dB	2,8 $\leq 3,4$
Vp RF Port	@50kHz	V	1,6 $\leq 2$
Electrical return loss S11	between 0 – 02GHz	dB	-10,1 $\leq -8$
Electro-optic bandwidth S21	@ -3dB, from 500MHz	GHz	>2 $> 2$

Position	Name/Visa	Date
Test engineer	A.POTHIER	2024-07-23

### Precautions of use :

For bias control and modulation signal, please refer to the Application Note "**LiNbO3 Intensity Modulators Bias Control and Modulation Driving**". This application note aims to give intensity modulators users the basics to select and apply the proper RF and bias voltages to their device and can be downloaded from our company website [www.photonics.ixblue.com](http://www.photonics.ixblue.com)

In order to avoid any damage to the modulator and to keep its performance at maximum, please pay a special attention to the following :

- When handling the modulator, do not apply any excessive tensile strength neither bend on the fiber pigtaills.
- Always keep the optical connectors end face protected and clean the optical connector end face with appropriate tissue before
- Clean RF connector with dry air before mating and use a torque wrench for tightening.
- Respect maximum ratings mentioned in accordance with specifications ([www.exail.com/event\\_category/photonics.com](http://www.exail.com/event_category/photonics.com))
- At the maximum optical power, fusion splices are expressly recommended to avoid permanent damage on optical connectors.
- In the case of optical instabilities, when operating at high optical power or shorter wavelength, it might be necessary to heat up the modulator (max 50°C)



EXAIL, Photonic Solutions Division  
3, rue Sophie Germain  
25000 Besançon, France  
Tél : +33 1 30 08 88 88  
Fax : +33 1 30 08 88 00