

PAA00797

Component

MXER-LN-20-PD-P-FA-FA-30dB

Serial number


15283-13

## WARNING : the short-circuit spring on the DC pins must be removed before use

Packaging-interfaces						
Input fiber	Polarization maintaining, Panda type					
Output fiber	Polarization maintaining, Panda type					
Jacket type	900µm outside diameter					
Input optical connector (orientation)	FC/APC	Key // slow axis				
Output optical connector (orientation)	FC/APC	Key // slow axis				
Input fiber length	1.5 meter					
Output fiber length	1.5 meter					
Input RF port	50Ω, female K					

## Product dimension and pin-out

Emcore laser module

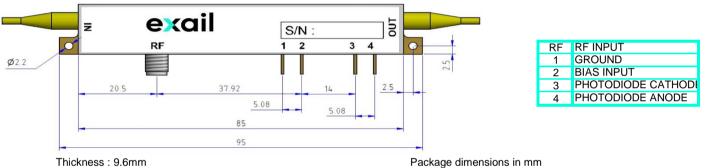

Thickness : 9.6mm Material : KOVAR

λ= 1550 nm

Parameters	Conditions		Measurements	Specifications
Insertion Loss	with input connection	dB	4,4	≤5.25
DC extinction ratio		dB	>30	>30
Internal photodiode responsivity	Reference : input power	A/W	0,017	
Vp RF Port	@50kHz	V	5,8	≤6.5
Vp DC Port	@100Hz	V	5,9	≤7
Electrical return loss S11	between 0 – 20GHz	dB	-11,5	≤-10
Electro-optic bandwidth S21	@ -3dB, from 2GHz	GHz	>18	>18
		OTIZ	210	210

Position	Name/Visa	Date
Test engineer	M.VOILLY	2024-03-08

Measured with :

## Precautions of use :

For bias control and modulation signal, please refer to the Application Note "LiNbO3 Intensity Modulators Bias Control and Modulation Driving". This application note aims to give intensity modulators users the basics to select and apply the proper RF and bias voltages to their device and can be downloaded from our company website www.photonics.ixblue.com

In order to avoid any damage to the modulator and to keep its performance at maximum, please pay a special attention to the following :

When handling the modulator, do not apply any excessive tensile strength neither bend on the fiber pigtails.

•• Always keep the optical connectors end face protected and clean the optical connector end face with appropriate tissue before

••• Clean RF connector with dry air before mating and use a torque wrench for tightening.

•••• Respect maximum ratings mentioned in accordance with specifications (www.exail.com/event\_category/photonics.com)

••••• At the maximum optical power, fusion splices are expressly recommended to avoid permanent damage on optical connectors.

•••••• In the case of optical instabilities, when operating at high optical power or shorter wavelength, it might be necessary to heat up the modulator (max 50°C)



EXAIL, Photonic Solutions Division 3, rue Sophie Germain 25000 Besançon, France Tél : +33 1 30 08 88 88 Fax : +33 1 30 08 88 00